

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	1504-3
Description	Tape Payroll
Model	Model I
Stock No.	26-1504 Version 1.2
Date	March 12, 1981
Page 1 of	2

Problem

Erratic line feeds with some printers when printing out checks or reports.

Solution

The problem is corrected by following the steps listed below.

1. CLOAD the PRPROC program.
2. Make the following changes:

CHANGES (Retype the line or refer to the Edit section of the owners manual)

Old Line: 2130 LPRINTCHR\$(138):NEXT:LPRINTCHR\$(12):LPRINTTAB(15);.....

New Line: 2130 LPRINT"__":NEXT:LPRINTCHR\$(12):LPRINTTAB(15);.....

Old Line: 2170 LPRINTTAB(10);C\$;V2;H\$;V4;DT\$:LPRINTCHR\$(138)

New Line: 2170 LPRINTTAB(10);C\$;V2;H\$;V4;DT\$:LPRINT"__"

Old Line: 2190 LPRINTSTRING\$(80,"="):LPRINTCHR\$(138):RETURN

New Line: 2190 LPRINTSTRING\$(80,"="):LPRINT"__":RETURN

Old Line: 3250 LPRINTCHR\$(138):LPRINTTAB(17);"COMM";TAB(26);USINGP3\$;R(I,5)

New Line: 3250 LPRINT"__":LPRINTTAB(17);"COMM";TAB(26);USINGP3\$;R(I,5)

Old Line: 3900 FORX=1TOLF:LPRINTCHR\$(138):NEXT:RETURN

New Line: 3900 FORX=1TOLF:LPRINT"__":NEXT:RETURN

3. Type CSAVE"A" to save the changes in the program.

CUSTOMER SERVICE BULLETIN

Subject Tape Payroll Bulletin # 1504-3 **Page** 2 **Of** 2

4. CLOAD THE PRTOT program.
5. Make the following corrections:

CHANGES (Retype the line or refer to the Edit section of the owners manual)

Old Line: 1080 LPRINTTAB(25);PR\$:LPRINTTAB(10)STRING\$(52,"-"):
LPRINTCHR\$(138)

New Line: 1080 LPRINTTAB(25);PR\$:LPRINTTAB(10)STRING\$(52,"-"):LPRINT"__"

Old Line: 1160 LPRINTTAB(10);C\$;" ";PR\$:LPRINTCHR\$(138)

New Line: 1160 LPRINTTAB(10);C\$;" ";PR\$:LPRINT"__"

Old Line: 1180 LPRINTSTRING\$(80,"="):LPRINTCHR\$(138):RETURN

New Line: 1180 LPRINTSTRING\$(80,"="):LPRINT"__":RETURN

6. Type CSAVE"A" to save the changes in the program.