

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No. 1559-05
Description Man. Inv. Control
Model Model III
Stock No. 26-1559 Version 1.2
Date May 27, 1981
Page 1 of 3

Problem

Pull sheets do not have proper alignment for all printers.

Solution

The problem is corrected by following the steps listed below.

NOTE: These corrections will fix the problem for all printers.

1. Backup the diskette(s) and make the changes on the Backup copy or the program.
2. In BASIC load the program by typing LOAD"REPORT1".
3. Make the following corrections:

CHANGES (Retype the line or refer to the Edit section of the owners manual)

Old Line: 700 FORX=1TOLF:LPRINTCHR\$(138):NEXT:RETURN

New Line: 700 FORX=1TOLF:LPRINT" ":NEXT:RETURN

Old Line: 820 FORX=1TO3:LPRINTTAB(24);GI\$(X):NEXT:LPRINTCHR\$(138)

New Line: 820 FORX=1TO3:LPRINTTAB(24);GI\$(X):NEXT:LPRINT" "

Old Line: 1820 LPRINTTAB(20);FG\$(N,0),FG\$(N,1):LPRINTSTRING\$(80,"*"):LPRINTCHR\$(138)

New Line: 1820 LPRINTTAB(20);FG\$(N,0),FG\$(N,1):LPRINTSTRING\$(80,"*"):LPRINT" "

Old Line: 1850 LPRINT" COST EXTENSION":LPRINTSTRING\$(80,"="):LPRINTCHR\$(138)

New Line: 1850 LPRINT" COST EXTENSION":LPRINTSTRING\$(80,"="):LPRINT" "

Old Line: 2250 EX#=EX#+CDBL(TP*CS):GOSUB2300:LPRINTCHR\$(138)

New Line: 2250 EX#=EX#+CDBL(TP*CS):GOSUB2300:LPRINT" "

CUSTOMER SERVICE BULLETIN

Subject MFG Inventory Control 1559-5

Page 2 Of 3

```
Old Line: 2260 NEXTY,X:LPRINTCHR$(138):LPRINTTAB(33);"**** TOTAL EXTENDED
COST .....";USING"#,#####.##";EX#:LPRINTCHR$(12)
New Line: 2260 NEXTY,X:LPRINT" ":LPRINTTAB(33);"**** TOTAL EXTENDED COST
.....";USING"#,#####.##";EX#:LPRINTCHR$(12);:POKE16425,1
Old Line: 2370 LPRINTSTRING$(80,"-"):LPRINTCHR$(138):RETURN
New Line: 2370 LPRINTSTRING$(80,"-"):LPRINT" ":RETURN
Old Line: 3070 IFS=2THENLPRINTW1$;TAB(54);W2$:LPRINTCHR$(138):GOTO3110
New Line: 3070 IFS=2THENLPRINTW1$;TAB(54);W2$:LPRINT" ":GOTO3110
Old Line: 1810 LPRINTCHR$(12):LPRINT" PAGE - ";P:LPRINTTAB(20);H$;
" ";DT$
New Line: 1810 LPRINTCHR$(12);:POKE16425,1:LPRINT" PAGE - ";P:
LPRINTTAB(20);H$;" ";DT$
Old Line: 2310 LPRINTCHR$(12):LPRINT" PAGE - ";P:LPRINTTAB(15);H$;" ";
DT$:P=P+1:LPRINTSTRING$(80,"=")
New Line: 2310 LPRINTCHR$(12);:POKE16425,1:LPRINT" PAGE - ";P:
LPRINTTAB(15);H$;" ";DT$:P=P+1:LPRINTSTRING$(80,"=")
Old Line: 3120 LPRINTCHR$(12):LPRINTTAB(20);"***** SUMMARY REPORT *****":
LF=3:GOSUB700
New Line: 3120 LPRINTCHR$(12);:POKE16425,1:LPRINTTAB(20);"***** SUMMARY
REPORT *****":LF=3:GOSUB700
Old Line: 3190 LPRINTCHR$(12):RETURN
New Line: 3190 LPRINTCHR$(12);:POKE16425,1:RETURN
Old Line: 3210 LPRINTCHR$(12):LPRINT" PAGE - ";P:P=P+1:LPRINTTAB(15);H$;
" ";DT$
New Line: 3210 LPRINTCHR$(12);:POKE16425,1:LPRINT" PAGE - ";P:
P=P+1:LPRINTTAB(15);H$;" ";DT$
Old Line: 4140 LPRINTSK$;TAB(25);DE$;TAB(63);USING"#####";NR:NEXT:
LPRINTCHR$(12):RETURN
New Line: 4140 LPRINTSK$;TAB(25);DE$;TAB(63);USING"#####";NR:NEXT:
LPRINTCHR$(12);:POKE16425,1:RETURN
```

4. Type SAVE"REPORT1" to save the changes in the program.
5. In BASIC load the next program by typing LOAD"REPORT2".
6. Make the following corrections:

CHANGES (Retype the line or refer to the Edit section of the owners manual)

```
Old Line: 700 FORX=1TOLF:LPRINTCHR$(138):NEXT:RETURN
New Line: 700 FORX=1TOLF:LPRINT" ":NEXT:RETURN
Old Line: 820 FORX=1TO3:LPRINTTAB(24);GI$(X):NEXT:LPRINTCHR$(138)
New Line: 820 FORX=1TO3:LPRINTTAB(24);GI$(X):NEXT:LPRINT" "
Old Line: 840 LPRINTTAB(40-LEN(H$)/2);H$:LPRINTCHR$(138)
New Line: 840 LPRINTTAB(40-LEN(H$)/2);H$:LPRINT" "
Old Line: 4030 LPRINTCHR$(138):LPRINTTAB(20)"STOCK NUMBER"TAB(40)
"DESCRIPTION":LPRINTTAB(20)STRING$(40,"-")
New Line: 4030 LPRINT" ":LPRINTTAB(20)"STOCK NUMBER"TAB(40)
"DESCRIPTION":LPRINTTAB(20)STRING$(40,"-")
```

CUSTOMER SERVICE BULLETIN

Subject MFG Inventory Control 1559-5 Page 3 Of 3

```
Old Line: 4250 NEXTY,X:LPRINTCHR$(138):LPRINTTAB(33)"**** TOTAL EXTENDED
VALUE ..... "USING"#####.##";EX#:LPRINTCHR$(12):RETURN
New Line: 4250 NEXTY,X:LPRINT" ":LPRINTTAB(33)"**** TOTAL EXTENDED
VALUE ..... "USING"#####.##";EX#:LPRINTCHR$(12);:
POKE16425,1:RETURN
Old Line: 4310 LPRINTCHR$(12):LPRINT" PAGE - ";P:P=P+1:LPRINTCHR$(138):
LPRINTTAB(15);H$;" ";DT$
New Line: 4310 LPRINTCHR$(12);:POKE16425,1:LPRINT" PAGE - ";P:
P=P+1:LPRINT" ":LPRINTTAB(15);H$;" ";DT$
Old Line: 4340 LPRINTSTRING$(80,"-"):LPRINTCHR$(138):RETURN
New Line: 4340 LPRINTSTRING$(80,"-"):LPRINT" ":RETURN
Old Line: 5115 LPRINTCHR$(138):LPRINTSTRING$(80,"=")
New Line: 5115 LPRINT" ":LPRINTSTRING$(80,"=")
Old Line: 5170 NEXTZ,X:LPRINTCHR$(138):LPRINTTAB(10)"***** END OF REPORT
*****":LPRINTCHR$(12):RETURN
New Line: 5170 NEXTZ,X:LPRINT" ":LPRINTTAB(10)"***** END OF
REPORT *****":LPRINTCHR$(12);:POKE16425,1:RETURN
Old Line: 5205 LPRINTCHR$(12):LPRINT" PAGE - ";P:LPRINTCHR$(138):LPRINT
TAB(15);H$+" ";DT$
New Line: 5205 LPRINTCHR$(12);:POKE16425,1:LPRINT" PAGE - ";P:
LPRINT" ":LPRINTTAB(15);H$+" ";DT$
Old Line: 4170 GOSUB10080:IFNF=0THEN4140ELSEQQ=QQ+1:IFPEEK(&H4029)>40
THENLPRINTCHR$(12):P=P+1
New Line: 4170 GOSUB10080:IFNF=0THEN4140ELSEQQ=QQ+1:IFPEEK(&H4029)>40
THENLPRINTCHR$(12);:POKE16425,1:P=P+1
```

7. Type SAVE"REPORT2" to save the changes in the program.
8. At TRSDOS Ready, make a backup copy of the corrected diskette.