

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	2283-81 (Correction 1)
Description	COBOL COMPILER
Model	Model I/III
Stock No.	26-2283 Version 1.3
Date	Nov. 16, 1981
Page 1 of	1

Problem

It's been reported that line feeds generated during run time cause an I/O ERROR CODE 38 when , in fact nothing is really wrong.

Solution

The problem may be corrected by applying the following patches on your Model I and Model III COBOL.

At TRSDOS READY key the following:

```
PATCH RUNCOBOL/CMD (ADD=A5F4,FIND=28,CHG=18)
PATCH RUNCOBOL/CMD (ADD=A682,FIND=28,CHG=18)
PATCH RUNCOBOL/CMD (ADD=A612,FIND=C2CEA6,CHG=8888888)
PATCH RUNCOBOL/CMD (ADD=A642,FIND=CA, CHG=C3)
PATCH RUNCOBOL/CMD (ADD=A653,FIND=C2CEA6,CHG=8888888)
PATCH RUNCOBOL/CMD (ADD=A665,FIND=CA,CHG=C3)
```

After applying these patches, line feeds to the printer will not cause I/O ERROR 38 to appear without a valid reason.