

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4531-16
Description	SCRIPSIT
Model	Model II
Stock No.	26-4531 Vers. 02.01.00
Date	May 3, 1983
Page 1 of	1

Problem

After applying patches for backspace distance, 10/12 pitch, and slash zero for use with the DWP410, the slash zero print feature does not work. The backspace routine during slashing of zeros fails to consider backspace distance.

* * THE FOLLOWING PATCHES ARE REQUIRED! * *

Solution

Apply the following patch to correct the backspace routine.

```
PATCH SCRIPSIT/SYS R=158 B=34 F=0608CD14F8 C=0000CDE8F7
```

Apply the following patch to change the version number.

```
PATCH STARTUP A=E301 F=20 C=31
```

After patches from this Bulletin have been applied, the version number will be 02.01.01. Please make the necessary entry in your Version Log.