

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4714-01
Description	REFORMATTER
Model	Model II
Stock No.	26-4714 Version 1.5
Date	August 10, 1981
Page 1 of	1

Problem

The REFORMATTER program contains an intermittent error when transferring TRSDOS FIXED LENGTH 1 LOGICAL RECORDS and VARIABLE LENGTH RECORDS to an IBM format LENGTH 128 LOGICAL RECORD. Sometimes, depending on the data, spurious characters are added to the end of the record in the IBM file.

Solution

To correct the problem, type the following patch at TRSDOS Ready.

```
PATCH REFM A=46D3 F=13C13E8090280B C=C13E8090280C13
```