

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4835-03
Description	SCRIPSIT 3.0
Model	Model 12/16
Stock No.	26-4835 Ver. 03.00.02
Date	September 27, 1983
Page 1 of	1

### Problem

There is erratic performance when a document is opened to store 84 lines per page. The last lines will scroll to the next page.

\* \* THE FOLLOWING PATCHES ARE REQUIRED! \* \*

### Solution

Apply the following patches to correct the problem.

```
PATCH SCRIPSIT/SYS R=166 B=61 F=34 C=33
PATCH SCRIPSIT/SYS R=91 B=204 F=34 C=33
PATCH SCRIPSIT/DEF R=03 B=42 F=54 C=53
```

Apply the following patch to change the Version Number to 03.00.03.

```
PATCH SCRIPSIT A=E330 F='2' C='3'
```

After patches from this Bulletin have been applied, the version number will be 03.00.03. Please make the necessary entry in your Version Log.