

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	491Ø-26
Description	TRSDOS
Model	Model II
Stock No.	26-491Ø Version 2.Ø
Date	March 12, 1982
Page 1 of	1

Problem

Pressing any key during a boot-up sequence initiated by the "reset" command causes unpredictable results if done prior to the date & time prompts.

Solution

The following patches will correct the problem.

```
PATCH SYSTEM/SYS R=6 B=133 F=3EØ1D3F9C3ØØØØ C=3EØ3D3F3C3C326  
PATCH SYSTEM/SYS R=6 B=196 F=E5E5E5E5E5E5E5E5 C=F33A55ØØCBAFD3FF  
PATCH SYSTEM/SYS R=6 B=2Ø4 F=E5E5E5E5E5E5E5E5 C=3EØ1D3F9C3ØØØØ
```