

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	491Ø-27
Description	TRSDOS
Model	Model II/16
Stock No.	26-491Ø Version 2.Øb
Date	August 13, 1982
Page 1 of	1

Problem

- (1) When using TRSDOS 2.Øb with some thin-line drives, ERROR 8 will occur when the drive is accessed. TRSDOS does not allow enough time to come up to speed before assuming a valid ERROR 8 has occurred.
- (2) There is an erroneous operator prompting for "Drive not Ready" when running FORMAT (either from within SCRIPST or from "TRSDOS READY").

* * THESE PATCHES ARE REQUIRED! * *

Solution

- (1) The following patch will remedy problem number one.

```
PATCH SYSRES/SYS A=1EF9 F=19 C=25
```

- (2) Apply the following patches to the FORMAT utility to correct problem number two.

```
PATCH FORMAT A=34C8 F=CD962DCD182D C=CDAF35ØØØØØØØØ
PATCH FORMAT A=352F F=FE51CA7828FE592ØEC C=FE59C27828ØØØØCDAF35
PATCH FORMAT A=35AF F=284D6F756E742Ø446973 C=CD962D474FCD322DCD32
PATCH FORMAT A=35B9 F=6B657474652Ø666F722Ø C=2DCD182DC9194D6F756E
PATCH FORMAT A=35C3 F=466F726D617474696E67 C=742Ø4469736B2Ø746F2Ø
PATCH FORMAT A=35CD F=2Ø6F6E2Ø4472697665 C=466F726D61742Ø6F6E
PATCH FORMAT A=283Ø F=AF C=BE
PATCH FORMAT A=35ØA F=2D C=29
PATCH FORMAT A=3511 F=26 C=22
PATCH FORMAT A=351D F=1A C=16
PATCH FORMAT A=3523 F=14 C=1Ø
```

**** NOTE **** The DO-file of patches for TRSDOS 2.Øb for the new thin-line disk drives ("THINLINE") must be installed prior to the installation of the above patches. These patches are not valid for TRSDOS 2.Øa.